

## CALIBRATING THE T-BAR




If you suspect that the T-BAR is not functioning properly, it might need re-calibration. A symptom of an incorrectly calibrated T-BAR might be that transitions do not run correctly from start-to-finish in each direction.

To re-calibrate the T-BAR:

- 1 Turn MXProDV off.
- 2 Press and hold SHIFT+INPUT EFFECTS while turning the unit back on.
- 3 Wait 10 seconds, then release SHIFT and INPUT EFFECTS.
- 4 Move the T-BAR near the top of its slot, then press the UP ARROW key. The Video LED (above the VIDEO/AUDIO selector) lights up.

VIDEO/AUDIO Selector

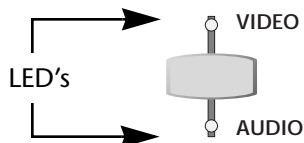

Do not push the T-BAR hard against the top or bottom of its slot during calibration. This over-calibrates the T-BAR and might prevent transitions from executing properly.

- 5 Move the T-BAR near the bottom of its slot, then press the DOWN ARROW key. The Audio LED (below the VIDEO/AUDIO selector) lights up.
- 6 Press OK.

All LED's on the unit go out and MXProDV automatically re-initializes itself. The T-BAR is now properly calibrated.